

Work Order: 413134

Status: Invoiced

Date:

3/20/2025

Location: PHILLIPS 66 #2830

Bill To: PHILLIPS 66

**Lucky Ghotra
702 LINCOLN WAY EAST
SOUTH BEND, IN 46615**

**702 LINCOLN WAY EAST
SOUTH BEND, IN 46615**

Solution Notes

[Issue:]check out violations
Luke h 3/20/25

Arrived on site and had to cut off the coax fill adapters on regular mid grade and premium. Checked drop tube and installed new adapters. The premium tank does not have any visible ball floats. The ball floats on diesel regular and mid grade tanks could not be removed. The diesel tank does not have any drop tube the regular and mid grade drop tubes fail the premium tube passed. Had to cut off two vapor adapters and one dust cap to check ball float. Filled out a quote request to replace bad mid grade spill container. The premium tank is a 2000 gallon tank and set correctly in the tank monitor. The kerosene tank is not in use and not being monitored.
