

Work Order: 413139

Status: Invoiced

Date:

3/19/2025

**Location: MAE'S MART / ABISIBI FOOD
MART**

**Lucky Ghotra
3204 MONROE STREET
LA PORTE, IN 46350**

Bill To: MAE'S MART (MOBIL)

**3204 MONROE STREET
LA PORTE, IN 46350**

Problem Notes

03/13/2025 13:46 BEN OLTHOFF

Lucky approved service calls to investigate the following issues sent in from Tanks Data:
Fill out relevant quote requests. Test results in Attachments

- HSC-Hydrostatic sump containment failed (T1)
 - RUL sump failed hydro. 1/4" was lost in an hour. Tester is guessing a boot is bad
- HSB-Hydrostatic spill bucket (both tanks)
 - Buckets failed hydro testing. Spill buckets are metal and considerably corroded. Tester says adapters might need to be changed
- Overfill prevention failed (both the tanks)
 - Ball floats could not be removed from the riser for inspection due to corrosion
- Sump Sensor Functionality (both tanks)
 - Sensors did not trigger an alarm when placed in the test liquid

Solution Notes

[Issue:] check novs

Luke h 3/19/25

Attempted to remove ball floats on site. Only the premium ball float was able to be removed. The regular vapor adapter and brass fill adapter had to be cut off and replaced. The tank monitor is missing a sensor card so the sensors could not be repaired. The regular stp is missing a secondary boot and needs to be repaired on a later date. Filled out a quote request form to replace both the regular and premium spill containers.

Subtotal:

SC/ST:

Total: