

## **Service Report**

Work Order: 415645

Status: Invoiced Date: 6/3/2025

Location: PHILLIPS 66 #18402 Bill To: PHILLIPS 66 #18402

**Lucky Ghotra** 

3301 PORTAGE AVENUE 3301 PORTAGE AVENUE SOUTH BEND, IN 46628 SOUTH BEND, IN 46628

## **Problem Notes**

06/03/2025 08:28 BEN OLTHOFF ADDITIONAL NOTE IDEM Violation

- 1) Piping Isolations for REG E & REG W piping metal connectors in contact with soil water mix.
  - Investigate if we can use our isolation sleeve to isolate the metal components from water/soil

## 06/02/2025 09:54 BEN OLTHOFF

Krishna approved of a service call for the following IDEM Violations:

- \*\*\*See pics in Attachments of damaged leak detectors\*\*\* \*\*\*IDEM Violations in Attachments\*\*\*
- 1) REG W & PREM Leak Detector damaged vent tube is damaged on both
  - Pics in Attachments of tubing pulled away
- 2) Please note that we are currently unable to retrieve the CSLD report from the ATG system following the recent repairs completed by B&K.
  - Investigate why site is unable to retrieve CSLD reporting
- 3) Clean Spill Bucket pictures
  - Investigate issue. Spills might just have to be drained. Take pics when completed

## **Solution Notes**

[Issue:]Novs Mark H. 6/3/25

Repaired brass tubing comming off of leak detectors in middle regular and premium stp sumps. Cleared out spill buckets and took pictures. Sumps are full of water and will need to be sucked out. Site will need to remediate issues of water comming into sumps or add anodes in stp sumps. Water did not look like it was comming in over the top. Pictures attached. Found csld was not turned on. Programed in csld site will motnitor.

Error: Subreport could not be shown.

**Subtotal:** \$306.00

**SC/ST:** \$0.00

**Total:** \$306.00