



INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT

We Protect Hoosiers and Our Environment.

100 N. Senate Avenue • Indianapolis, IN 46204

(800) 451-6027 • (317) 232-8603 • www.idem.IN.gov

Eric J. Holcomb
Governor

Brian C. Rockensuess
Commissioner

December 1, 2022

Kingsford Heights Property LLC
Attn: Mandeep Singh, Registered Agent
6520 Lake Crest Cir
South Bend, IN 46628

Kingsford Heights Property LLC
Attn: Mandeep Singh
Via email: luckyghotra95@ymail.com

Re: Violation Letter
Knoll Brothers Retail 2
8498 S US Hwy 6
Hamlet, Laporte County
UST Facility ID # **16625**

Dear Mr. Singh:

An inspector from the Indiana Department of Environmental Management (IDEM), Underground Storage Tank (UST) Section, conducted an inspection of the site referenced above on November 17, 2022.

The inspection was conducted pursuant to Indiana Code (IC) 13-14-2-2 to determine compliance with the provisions of IC 13-23 and 329 IAC 9. In accordance with IC 13-14-5, a summary of the inspection is provided below:

Type of Inspection: Initial

Results of Inspection: Violations were discovered and require a submittal.

Within thirty (30) days of receipt of this letter, documentation demonstrating compliance with each of the requirements listed in the attached Inspection Report and Description of Violations (DOV) must be submitted to IDEM. Failure to submit this documentation may lead to this facility being referred for enforcement.

An enforcement action may include civil penalties of up to \$10,000 per UST. Enforcement actions may also affect the owner's and/or operator's eligibility for reimbursement from the Excess Liability Trust Fund (ELTF). Additionally, IDEM may deem the USTs at this facility ineligible for delivery, deposit or acceptance of regulated substances pursuant to IC 13-23-1-4. Finally, federal and criminal penalties may apply for failure to provide required notification; or submitting false information pursuant to IC 13-23-14-2 and liable under IC 13-30-10.

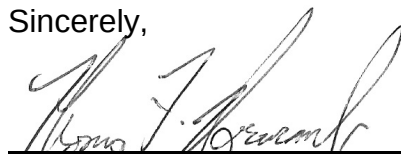
Thank you for your attention to this matter. Please submit the required documents to the UST Section via email at USTCompliance@idem.in.gov. Include in the subject line of the response the UST Facility ID # **16625**.

Inspector: Matt Rozycki
Phone: (317) 296-1853

Direct any questions regarding the inspection to:

Compliance Manager: Carrie Maniet
Phone: (317) 233-3533

Sincerely,

A handwritten signature in black ink, appearing to read "Thomas F. Newcomb", written over a horizontal line.

Thomas F. Newcomb, Chief
UST Compliance Section
Office of Land Quality

cc: Carrie Maniet
Matt Rozycki
UST Facility ID File # 16625

DESCRIPTION OF VIOLATIONS

This inspection or records review revealed that the owner and/or operator of this facility is in violation of Indiana UST Rule 329 IAC 9. 329 Indiana Administrative Code ("IAC") 9 incorporates certain federal underground storage tank requirements found in 40 Code of Federal Regulations ("CFR") Part 280, including those identified below. The Description of Violations (DOV) and corrective measures are as follows:

FACILITY NAME: Knoll Brothers Retail 2	UST FACILITY ID: 16625
ADDRESS: 8498 S US Hwy 6, Hamlet, LaPorte County	INSPECTION DATE: 11/17/2022

VIOLATIONS NOTED IN THIS INSPECTION

IC 13-23-12-1 Failure to Pay UST Fees

Citation:

Pursuant to IC 13-23-12-1, each year, if an underground storage tank has not been closed before January 1 of the year under rules adopted under IC 13-23-1-2; or a requirement imposed by the commissioner before the adoption of rules under IC 13-23-1-2; the owner of the underground storage tank shall pay to the department an annual registration fee.

The annual registration fee required by this section is ninety dollars (\$90) for each underground petroleum storage tank or two hundred forty-five dollars (\$245) for each underground storage tank containing regulated substances other than petroleum.

If an underground storage tank consists of a single tank in which there are separate compartments, a separate fee shall be paid under subsection (b) for each compartment within the single tank. If an underground storage tank consists of a combination of tanks, a separate fee shall be paid under subsection (b) for each compartment within each tank in the combination of tanks.

For tanks that contain separate compartments and that were in use before July 1, 2014, the payment of a single annual fee of ninety dollars (\$90) for a tank containing separate compartments shall be deemed to satisfy the requirements of subsection.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because fees are owed totaling \$360.

Corrective Action:

The owner and/or operator of the UST systems at this site shall pay the required fees to the Indiana Department of Environmental Management within fifteen (15) days of receipt of this notice.

329 IAC 9-2-2(c) – Failure to register/notify with complete information

Citation:

Pursuant to 329 IAC 9-2-2(c), an owner required to submit a notification under this section shall provide:

- (1) a notification for each UST owned;
- (2) complete information required on the form for each UST owned; and
- (3) if applicable, a separate notification form for each separate place of operation at which the USTs are located.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because an updated notification form is needed reflecting the proper ownership information. The date the new piping was installed needs to be noted with the use of interstitial monitoring for the piping release detection.

Corrective Action:

The owner and/or operator of the UST systems at this site shall fill out and submit to IDEM a correct and complete copy of the appropriate state form with required attachments, within fifteen (15) days of receipt of this notice.

§ 280.34 – Reporting and recordkeeping (general provisions)

Citation:

Pursuant to 40 CFR 280.34, owners and operators of UST systems must cooperate fully with inspections, monitoring and testing conducted by the implementing agency, as well as requests for document submission, testing, and monitoring by the owner or operator pursuant to section 9005 of Subtitle I of the Solid Waste Disposal Act, as amended.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because no records were provided at the time of the records request.

Corrective Action:

The owner and/or operator of the UST systems at this site shall immediately perform the monitoring or testing required by the rules and/or submit the requested documentation within seven (7) days of receipt of this notice.

329 IAC 9-8-11(b) – Failure to demonstrate the ability to pay the deductible amount

Citation:

Pursuant to 329 IAC 9-8-11(b), an owner or operator of:

- (1) twelve (12) or fewer USTs shall demonstrate the ability to pay the applicable deductible amount under IC 13-23-9-1.3; or
- (2) more than twelve (12) USTs shall demonstrate the ability to pay two (2) times the applicable deductible amount under IC 13-23-9-1.3.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because no financial responsibility mechanism was provided.

Corrective Action:

The owner and/or operator of the UST systems at this site shall submit a copy of the instrument proving they have the coverage required by this rule within thirty (30) days of receipt of this notice.

§ 280.20(c)(1)(ii) – Failure to have overfill prevention equipment installed or installed properly

Citation:

Pursuant to 40 CFR 280.20(c)(1)(ii), to prevent spilling and overfilling associated with product transfer to the UST system, owners and operators must use the following spill and overfill prevention equipment:

(ii) Overfill prevention equipment that will:

(A) Automatically shut off flow into the tank when the tank is no more than 95 percent full; or

(B) Alert the transfer operator when the tank is no more than 90 percent full by restricting the flow into the tank or triggering a high-level alarm; or

(C) Restrict flow 30 minutes prior to overfilling, alert the transfer operator with a high level alarm one minute before overfilling, or automatically shut off flow into the tank so that none of the fittings located on top of the tank are exposed to product due to overfilling.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because the site has a history of ball floats, however; at the time of inspection, auto shut off devices were noted on site. Having both forms of overfill can hinder the other from working properly.

Corrective Action:

The owner and/or operator of the UST systems at this site shall, within thirty (30) days of receipt of this notice, contract with a certified contractor to install or replace absent or substandard overfill prevention equipment that will operate as required. The UST owner and/or operator must submit proof that the overfill prevention equipment has been installed properly to the 90% or 95% fill level as required by the type of equipment within forty five (45) days of receipt of this notice. In the case where an owner has changed the overfill prevention equipment from a flow restrictor (ball float) to an auto-shutoff device, the owner must document the entire flow restrictor has been removed or that the automatic shut off device is installed at 90% or lower.

§ 280.20(b) – Failure to install, design, construct or protect piping from corrosion

Citation:

Pursuant to 40 CFR 280.20(b), the piping that routinely contains regulated substances and is in contact with the ground must be properly designed, constructed, and protected from corrosion in accordance with a code of practice developed by a nationally recognized association or independent testing laboratory.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because metal components of the piping appeared to be in contact with backfill in the STP risers.

Corrective Action:

The owner and/or operator of the UST systems at this site shall, within fifteen (15) days of receipt of this notice, contract with a certified contractor to determine if the piping or metal components in contact with the ground are substandard and what steps will be taken to provide corrosion protection. The UST owner and/or operator must inform IDEM of the proposed work within thirty (30) days of receipt of this notice and receive approval before completing the work. The work must be completed within forty five (45) days of receipt of this notice. If the piping or metal components are determined to be substandard, the UST owner and/or operator shall immediately notify IDEM of their intent to remove or replace the affected components.

§ 280.20(c)(1)(i) – Failure to have spill prevention equipment that will prevent release

Citation:

Pursuant to 40 CFR 280.20(c)(1)(i), to prevent spilling and overfilling associated with product transfer to the UST system, owners and operators must use the following spill and overfill prevention equipment:

(i) Spill prevention equipment that will prevent release of product to the environment when the transfer hose is detached from the fill pipe (for example, a spill catchment basin).

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because the spill buckets contained excessive fluid and may not contain a spill if needed.

Corrective Action:

The owner and/or operator of the UST systems at this site shall, within thirty (30) days of receipt of this notice, contract with a certified contractor to install or replace absent or substandard spill prevention equipment that will prevent the release of product to the environment. The UST owner and/or operator must submit proof that the spill prevention equipment has been installed within forty five (45) days of receipt of this notice.

§ 280.35(a)(1) – Failure to perform periodic testing of spill prevention equipment and containment sumps used for IM

Citation:

Pursuant to 40 CFR 280.35(a)(1), owners and operators of UST systems with spill and overfill prevention equipment and containment sumps used for interstitial monitoring of piping must meet these requirements to ensure the equipment is operating properly and will prevent releases to the environment:

(1) Spill prevention equipment (such as a catchment basin, spill bucket, or other spill containment device) and containment sumps used for interstitial monitoring of piping must prevent releases to the environment.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because periodic testing of the spill prevention equipment was not provided.

Corrective Action:

The owner and/or operator of the UST systems at this site shall, within thirty (30) days of receipt of this notice, contract with a certified contractor to inspect, repair and test all spill prevention equipment and containment sumps. Documentation, to include photographs, inspection, repair and testing results, showing the spill prevention equipment and containment sumps are liquid tight must be submitted within forty five (45) days of the receipt of this notice.

§ 280.35(a)(2) – Failure to perform periodic testing of overfill prevention equipment

Citation:

Pursuant to 40 CFR 280.35(a)(2), overfill prevention equipment must be inspected at least once every three years. At a minimum, the inspection must ensure that overfill prevention equipment is set to activate at the correct level specified in § 280.20(c) and will activate when regulated substance reaches that level. Inspections must be conducted in accordance with one of the criteria in paragraph (a)(1)(ii)(A) through (C) of this section.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because periodic testing of the overfill prevention equipment was not provided.

Corrective Action:

The owner and/or operator of the UST systems at this site shall, within thirty (30) days of receipt of this notice, contract with a certified contractor to inspect, repair and test all overfill prevention equipment. Documentation, to include photographs, inspection, repair, measurements and testing results, showing the overfill prevention equipment is fully functional and set at the correct level must be submitted within forty five (45) days of the receipt of this notice.

§ 280.36(a)(1)(i) – Failure to perform 30 day walkthrough inspections
Citation:
Pursuant to 40 CFR 280.36(a)(1)(i), to properly operate and maintain UST systems, not later than June 28, 2021, owners and operators must conduct a walkthrough inspection every 30 days that, at a minimum, checks spill prevention equipment and release detection equipment (Exception: spill prevention equipment at UST systems receiving deliveries at intervals greater than every 30 days may be checked prior to each delivery).
Violation Details:
<i>The owner and/or operator of the UST system(s) at this site are in violation of this rule because monthly walkthroughs were not provided.</i>
Corrective Action:
The owner and/or operator of the UST systems at this site shall, within seven (7) days of receipt of this notice, perform the 30 day walkthrough inspection for all UST systems at the site in accordance with a standard of practice referenced in the rule. Documentation, to include photographs, inspection forms, repair documents, and waste disposal records, showing the walkthrough inspection has been completed must be submitted within forty five (45) days of the receipt of this notice.
§ 280.36(a)(1)(ii) – Failure to perform annual walkthrough inspections
Citation:
Pursuant to 40 CFR 280.36(a)(1)(ii), to properly operate and maintain UST systems, not later than June 28, 2021 owners and operators must conduct a walkthrough inspection annually that, at a minimum, checks containment sumps and hand held release detection equipment.
Violation Details:
<i>The owner and/or operator of the UST system(s) at this site are in violation of this rule because the annual walkthrough inspection was not provided.</i>
Corrective Action:
The owner and/or operator of the UST systems at this site shall, within seven (7) days of receipt of this notice, perform the annual walkthrough inspection for all UST systems at the site in accordance with a standard of practice referenced in the rule. Documentation, to include photographs, inspection forms, repair documents, and waste disposal records, showing the walkthrough inspection has been completed must be submitted within forty five (45) days of the receipt of this notice.

§ 280.31(b) – Failure to inspect CP system, frequency and criteria

Citation:

Pursuant to 40 CFR 280.31(b), all UST systems equipped with cathodic protection systems must be inspected for proper operation by a qualified cathodic protection tester in accordance with the following requirements:

- (1) Frequency. All cathodic protection systems must be tested within 6 months of installation and at least every 3 years thereafter or according to another reasonable time frame established by the implementing agency; and
- (2) Inspection criteria. The criteria that are used to determine that cathodic protection is adequate as required by this section must be in accordance with a code of practice developed by a nationally recognized association.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because Corrosion Protection testing results were not provided for the tanks.

Corrective Action:

The owner and/or operator of the UST systems at this site shall submit to IDEM the required documents within fifteen (15) days of receipt of this notice or have their UST systems fully inspected by a qualified cathodic protection tester within fifteen (15) days and submit the results within thirty (30) days of receipt of this notice.

§ 280.40(a)(3)(i) – Failure to perform annual tests of ATG

Citation:

Pursuant to 40 CFR 280.40(a)(3)(i), owners and operators of UST systems must provide a method, or combination of methods, of release detection that beginning on October 13, 2018, is operated and maintained, and electronic and mechanical components are tested for proper operation, in accordance with one of the following: manufacturer's instructions; a code of practice developed by a nationally recognized association or independent testing laboratory; or requirements determined by the implementing agency to be no less protective of human health and the environment than the two options listed in paragraphs (a)(1) and (2) of this section. A test of the proper operation must be performed at least annually and, at a minimum, as applicable to the facility, cover the following components and criteria:

- (i) Automatic tank gauge and other controllers: test alarm; verify system configuration; test battery backup.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because an ATG functionality test was not provided.

Corrective Action:

The owner and/or operator of the UST systems at this site shall have all components of the automatic tank gauge or other controllers tested for proper operation within thirty (30) days of receipt of this notice and submit the results within forty five (45) days of receipt of this notice.

§ 280.40(a)(3)(ii) – Failure to perform annual tests of probes & sensors

Citation:

Pursuant to 40 CFR 280.40(a)(3)(ii), owners and operators of UST systems must provide a method, or combination of methods, of release detection that beginning on October 13, 2018, is operated and maintained, and electronic and mechanical components are tested for proper operation, in accordance with one of the following: manufacturer's instructions; a code of practice developed by a nationally recognized association or independent testing laboratory; or requirements determined by the implementing agency to be no less protective of human health and the environment than the two options listed in paragraphs (a)(1) and (2) of this section. A test of the proper operation must be performed at least annually and, at a minimum, as applicable to the facility, cover the following components and criteria:

(ii) Probes and sensors: inspect for residual buildup; ensure floats move freely; ensure shaft is not damaged; ensure cables are free of kinks and breaks; test alarm operability and communication with controller.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because a functionality test of the probes was not provided.

Corrective Action:

The owner and/or operator of the UST systems at this site shall have all components of the automatic tank gauging probes and sensors tested for proper operation within thirty (30) days of receipt of this notice and submit the results within forty five (45) days of receipt of this notice.

§ 280.40(a)(3)(iii) – Failure to perform annual tests of ALLD

Citation:

Pursuant to 40 CFR 280.40(a)(3)(iii), owners and operators of UST systems must provide a method, or combination of methods, of release detection that beginning on October 13, 2018, is operated and maintained, and electronic and mechanical components are tested for proper operation, in accordance with one of the following: manufacturer's instructions; a code of practice developed by a nationally recognized association or independent testing laboratory; or requirements determined by the implementing agency to be no less protective of human health and the environment than the two options listed in paragraphs (a)(1) and (2) of this section. A test of the proper operation must be performed at least annually and, at a minimum, as applicable to the facility, cover the following components and criteria:
(iii) Automatic line leak detector: test operation to meet criteria in § 280.44(a) by simulating a leak.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because an annual leak detector test was not provided.

Corrective Action:

The owner and/or operator of the UST systems at this site shall have the automatic line leak detectors tested for proper operation by simulating a leak within thirty (30) days of receipt of this notice and submit the results within forty five (45) days of receipt of this notice.

§ 280.41(a)(1) – Failure to monitor tanks every 30 days if installed before 9/2/2009

Citation:

Pursuant to 40 CFR 280.41(a)(1), considering previous Indiana rule at 329 IAC 9-3-1.3 (repealed 2018), tanks installed on or before September 2, 2009 must be monitored for releases at least every 30 days using one of the methods listed in § 280.43(d) through (i).

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because 12 months of release detection records were not provided.

Corrective Action:

The owner and/or operator of the UST systems at this site shall have any UST or line that contains a regulated amount of product and found to not have been monitored every thirty (30) days tightness tested within thirty (30) days of receipt of this notice and submit the results within forty five (45) days of receipt of this notice. The owner and/or operator shall continue to perform proper monthly release detection and submit the results monthly for a period of six (6) months after the receipt of this notice.

§ 280.41(b)(2) – Failure to perform monthly monitoring on piping installed after 9/2/2009, except proper European

Citation:

Pursuant to 40 CFR 280.41(b)(2), piping installed or replaced after April 11, 2016 (previously cited as September 2, 2009 under 329 IAC 9-2-1(2)(D)) must meet one of the following:

- (i) Pressurized piping must be monitored for releases at least every 30 days in accordance with § 280.43(g) and be equipped with an automatic line leak detector in accordance with § 280.44(a)
- (ii) Suction piping must be monitored for releases at least every 30 days in accordance with § 280.43(g).

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because the piping appears to have been installed after 9/2/2009 and interstitial monitoring release detection records were not provided.

Corrective Action:

The owner and/or operator of the UST systems at this site shall have any UST or line that contains a regulated amount of product and found to not have been monitored every thirty (30) days by not having records of interstitial monitoring tightness tested within thirty (30) days of receipt of this notice and submit the results within forty five (45) days of receipt of this notice. The owner and/or operator shall continue to perform proper monthly release detection and submit the results monthly for a period of six (6) months after the receipt of this notice.

§ 280.43(g) – Failure to perform Interstitial Monitoring to standard

Citation:

Pursuant to 40 CFR 280.43(g), interstitial monitoring between the UST system and a secondary barrier immediately around or beneath it may be used, but only if the system is designed, constructed, and installed to detect a leak from any portion of the tank that routinely contains product and also meets one of the following requirements:

- (1) For double walled UST systems, the sampling or testing method can detect a leak through the inner wall in any portion of the tank that routinely contains product;
- (2) For UST systems with a secondary barrier within the excavation zone, the sampling or testing method used can detect a leak between the UST system and the secondary barrier.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because the piping appears to have been upgraded after 9/2009 and is required to perform interstitial monitoring as the release detection method. There are no STP sumps and no sensors in the UDCs.

Corrective Action:

The owner and/or operator of the UST systems at this site shall have any UST or piping that contains a regulated amount of product and found to not have been monitored every thirty (30) days correctly while using interstitial monitoring tightness tested within thirty (30) days of receipt of this notice and submit the results within forty five (45) days of receipt of this notice. The owner and/or operator shall continue to perform proper monthly release detection and submit the results monthly for a period of six (6) months after the receipt of this notice.

§ 280.245 – Failure to maintain list of designated operators and/or training records

Citation:

Pursuant to 40 CFR 280.245, owners and operators of underground storage tank systems must maintain a list of designated Class A, Class B, and Class C operators and maintain records verifying that training and retraining, as applicable, have been completed, in accordance with § 280.34.

Violation Details:

The owner and/or operator of the UST system(s) at this site are in violation of this rule because operator A, B, and C certificates are needed.

Corrective Action:

The owner or operator of the UST systems at this site shall submit a list of those employees designated to be Class A, Class B and Class C operators. Those so designated must be trained and certification of that training submitted within thirty (30) days of receipt of this notice.



UNDERGROUND STORAGE TANK INSPECTION REPORT

INDIANA DEPARTMENT OF
ENVIRONMENTAL MANAGEMENT

UST FAC ID: **16625**

Inspector's Name:	Matt Rozycki
Date:	November 17, 2022
Time In:	10:20
Time Out:	10:45
Inspection Type:	Initial

FACILITY NAME / LOCATION					
FACILITY NAME Knoll Brothers Retail 2			FACILITY ADDRESS (number and street) 8498 S US Hwy 6		
ADDRESS (line 2)		CITY Hamlet	STATE IN	ZIP CODE 46532	COUNTY Laporte
UST OWNER					
UST Owner Name (If in Individual Capacity) Kingsford Heights Property LLC				BUSINESS ID (From the Secretary of State)	
PREFIX	FIRST NAME Mandeep	MI	LAST NAME Singh		SUFFIX
TELEPHONE NUMBER		EMAIL ADDRESS luckyghotra95@gmail.com			
UST OPERATOR					
UST Operator Name (If in Individual Capacity) Kingsford Heights Property LLC				BUSINESS ID (From the Secretary of State)	
PREFIX	FIRST NAME Mandeep	MI	LAST NAME Singh		SUFFIX
TELEPHONE NUMBER		EMAIL ADDRESS luckyghotra95@gmail.com			
PROPERTY OWNER					
UST Property Owner Name (If in Individual Capacity) Kingsford Heights Property LLC				BUSINESS ID (From the Secretary of State)	
PREFIX	FIRST NAME Mandeep	MI	LAST NAME Singh		SUFFIX
TELEPHONE NUMBER		EMAIL ADDRESS luckyghotra95@gmail.com			
COMPLIANCE ELEMENTS					
All USTs properly registered and up-to-date notification form on file			☐ YES	☒ NO	☐ UNK
Fees owed \$360.00, updated notification form reflecting the proper ownership and UST system information					
O/O is in compliance with reporting & record keeping requirements			☐ YES	☒ NO	☐ UNK
No records were provided					
O/O is in compliance with release reporting or investigation			☐ YES	☐ NO	☒ N/A
O/O is in compliance with all UST closure requirements			☒ YES	☐ NO	☐ N/A
O/O has met all financial responsibility requirements			☐ YES	☒ NO	☐ N/A
No financial responsibility mechanism was provided					
40 CFR 280, Subpart A installation requirements (partially excluded) met			☒ YES	☐ NO	☐ N/A
40 CFR 280, Subpart B installation and upgrade requirements met			☐ YES	☒ NO	☐ UNK
Possible ball float / auto shut off coincidental use, metal components of piping touching backfill					
40 CFR 280, Subpart C spill/overfill control requirements met			☒ YES	☐ NO	☐ N/A
40 CFR 280, Subpart C compatibility requirements met			☒ YES	☐ NO	☐ N/A
40 CFR 280, Subpart C O&M and testing requirements met			☐ YES	☒ NO	☐ UNK
Spill bucket testing, overfill functionality, monthly / annual walkthroughs, corrosion testing					
40 CFR 280, Subpart D release detection requirements met			☐ YES	☒ NO	☐ UNK
ATG/probes testing, leak detector test, monthly records, line tightness test, interstitial monitoring					
40 CFR 280, Subpart J operator training requirements met			☐ YES	☒ NO	☐ UNK
Operator A B & C certificates were not provided					

The information contained on this page is based upon a review of files related to this site and/or observations from an underground storage tank inspector. This page may contain information not specifically related to possible violations found during the review or inspection and is meant to give the owners and/or operator specific information to assist them.

Site Maintains two (2) USTs - STIP3 - Installed 11/22/1990

One (1) 10K GSL

One (1) 6K GSL

Section Chief Note: The normal operational lifespan of a UST before failing is 25 to 30 years old. The USTs at this site are now 32 years old, likely out of warranty and the owner should already be planning on removing or replacing them soon.

Piping - SW FG - Pressurized

RD UST - ATG

RD Piping - ATG - LD

Spill protection/Overfill - Spill bucket - Flapper & Ball float ? Alarm

ATG Certification = N

Overfill Protection Test = N

Spill bucket Test = N

Containment Sumps Test Required N

Last known CP 10/10/2012

Site is an active gas station

Any Site history or concerns - Kingsford Heights Property LLC not found on SOS and shows as property owner as of 5/25/2022.

Three USTs closed 11/1/1989 (Closure NF on file)

Documentation received -

Notification form - Need with new ownership info

No additional documents received at time of review

Documentation needed -

RD UST monthly results -

RD Piping

LD

Annual ATG test

Overfill test required every 3 years

Spill bucket test required every 3 years

Monthly walk through

Annual walk through

Operator certificate - A-B-C

FR

***Attendant said they did not have a UST binder - merchant certificate in compliance photos

The information contained on this page is based upon a review of files related to this site and/or observations from an underground storage tank inspector. This page may contain information not specifically related to possible violations found during the review or inspection and is meant to give the owners and/or operator specific information to assist them.

The following are VIOLATIONS discovered during the inspection that will need to be corrected within 30 days of receipt of this inspection report to avoid further action and achieve compliance with the state underground storage tank program:

1. Fees are owed totaling \$360
2. An updated notification form is needed reflecting the proper ownership information. The date the new piping was installed needs to be noted and the use of interstitial monitoring for the piping needs to be noted
3. No records were provided
4. No financial responsibility mechanism was provided
5. Possible ball float / auto shut off coincidental use. The site has a history of ball floats, however; at the time of inspection, auto shut off devices were observed on site. Having both forms of overfill can cause problems
6. Metal components of the piping appeared to be in contact with backfill at the STP risers
7. The spill buckets contained excessive fluid and may not contain a spill if needed
8. Spill bucket testing was not provided
9. Overfill functionality testing was not provided
10. Monthly walkthroughs were not provided
11. An annual walkthrough inspection was not provided
12. Corrosion protection testing was not provided for the tanks
13. ATG functionality testing was not provided
14. Functionality testing of the probes was not provided
15. An annual leak detector test was not provided
16. Monthly release detection records were not provided for the tanks
17. The piping appears to have been upgraded after 9/2009 and is required to perform interstitial monitoring as the release detection method. There are no STP sumps which are required, and no sensors in the UDCs
18. Operator A B & C certificates were not provided

The following are RECORDS to be submitted to USTCompliance@idem.IN.gov with FID in subject line within 30 days of receipt of this inspection report to avoid further action and achieve compliance with the state underground storage tank program:

- Fees
- Notification form
- Financial responsibility mechanism
- Ball float removal / auto shut off adjustment to 90%
- Proof metal components are corrosion protected
- Spill bucket clean out
- Spill bucket test
- Overfill test
- Walkthroughs
- Leak detector test
- Line tightness test
- ATG/probes test
- Proof interstitial monitoring has been brought up to standard
- Operator certificates
- Corrosion protection testing