

## **Service Report**

Work Order: 419772

Status: Scheduled Date: 10/10/2025

Location: Kingsford Expo 66 Bill To: Kingsford Expo 66

**Jay Singh** 

8498 S US Hwy 6 Hamlet, IN 46532 8498 S US Hwy 6 Hamlet, IN 46532

## **Problem Notes**

10/15/2025 14:10 Blake Rispens JOB 6

10/10/2025 11:03 Blake Rispens See Blake/Mitch for drop tube

10/08/2025 09:01 Steve Huizenga Subhan set to be at the site 8AM 10/10

10/03/2025 15:40 DJ White

NOV

- •Install jumper tubing in UDCs 1/2, 3/4 and "plug bolts" in 5/6 (i think they meant shrader valves)
- Hydro test 3 UDCs
- •Confirm ball float removal or drop tubes set at 90%. Bring vapor adapters. Check for/remove ball floats, check what height drop tubes are set to.
- •Line test 3 lines

## **Solution Notes**

[Issue:] testing Seamus P 10/10/25

Completed testing as was required. Tested three lines and two leak detectors. Hydro tested 5 containments. Removed ball floats on RUL and PUL. RUL drop tube failed testing due to missing flapper. Need to return to install new drop tube for RUL and jumper tubing under dispenser 1/2 and 3/4. Need to plug secondary fittings under 5/6. Opw flex pipe. Need to install jbox in RUL and PUL transition sump. Pictures are attached.

Error: Subreport could not be shown.

Subtotal:

SC/ST:

**Total:** \$0.00