

Work Order: 401813

Status: Invoiced

Date:

4/30/2024

Location: GO LO

Bill To: GO LO

**SINGH
3479 GEORGIA STREET
GARY, IN 46409**

**3479 GEORGIA STREET
GARY, IN 46409**

Problem Notes

04/24/2024 10:31 ED ANGELL
Add sign to e-stop at counter.

04/24/2024 10:26 ED ANGELL
check Regular STP area for signs of fuel release and check if liquid in sump is water or fuel.

04/23/2024 13:23 DANIELLE BOLTE
THE ZERO BUTTON IS NOT WORKING FOR BOTH REGISTER
WHEN PEOPLE USE THE CREDIT CARD, WANTS TO SKIP THE "ENTER PIN"

Solution Notes

[Issue:] Patrick 2/29/24
Found both c18 zero and clear keys not working. Replaced keyboards under Verifone part warranty. Installed emergency stop sign by switch. Found regular sump has a lot of gasoline in it. Put gauge in line and pressure seems to be holding. Will meet GFL at 8am on 4/30/24 to suck sumps and dispensers dry and inspect for leaks.

[Issue:]Regular STP Inspection (XST System)
4/30/24
Brandon H.

Arrived and found regular STP full, with approximately 3" of fuel on top of water. Dirt around regular STP wet and stained. Removed all liquid from regular STP and found water flowing back through secondary from dispensers. All dispenser sumps between 6-12" of water underneath. Ran all dispensers and no leaks found. No leaks found at motor. Removed all water from premium STP. No fuel found in premium STP. Submitted quote request to raise both STP's and replace broken regular lid and missing gasket.

Error: Subreport could not be shown.

Subtotal:	\$729.99
SC/ST:	\$1.68
Total:	<u>\$731.67</u>