



UST TESTING/INSPECTION RESULTS SUMMARY

OWNER NAME: Tanks Data
 OWNER ADDRESS: 53031 State Road 13
 OWNER CITY/STATE/ZIP: Middlebury, IN 46540

LOCATION NAME: Snappy Food Mart
 LOCATION ADDRESS: 53031 State Road 13
 LOCATION CITY/STATE: Middlebury, IN 46540
 LOCATION FID#: 19871

TESTING DATE: 8/29/2023

THREE YEAR TESTS/INSPECTIONS

SPILL BUCKET INTERGRITY TESTING

COMPLETED

TANK NO	PRODUCT	CONSTRUCTION	RESULT
1	RUL	Single-Walled	PASS
2	PUL	Single-Walled	PASS
3	DSL	Single-Walled	PASS
4	KER	Single-Walled	FAIL

HYDROSTATIC SUMP TEST

NOT PERFORMED

SUMP ID	MATERIAL	DEPTH	HYDROSTATIC RESULT	VISUAL RESULT

OVERFILL EQUIPMENT INSPECTION

COMPLETED

TANK	PRODUCT	TYPE	BALL FLOAT RESULT	AUTO SHUT OFF RESULT
1	KER	Ball Float Valve	UNTESTABLE	
2	DSL	Ball Float Valve	UNTESTABLE	
3	RUL	Ball Float Valve	UNTESTABLE	
4	PUL	Ball Float Valve	UNTESTABLE	

OVERFILL ALARM TEST

NOT PERFORMED

TANK	PRODUCT	BRAND/MODEL	RESULT

LEGEND:


RUL	Regular Unleaded
DSL	Diesel
PUL	Premium Unleaded
KER	Kerosene
ODSL	Off Road Diesel
REC	Recreational

SITE PHOTOS

TEST DATE: 8/29/2023
LOCATION NAME: Snappy Food Mart
LOCATION ADDRESS: 53031 State Road 13
LOCATION CITY/STATE: Middlebury, IN 46540
LOCATION PHONE: 0
LOCATION CONTACT: Virender Kumar

OWNER NAME: Tanks Data
OWNER ADDRESS: 53031 State Road 13
OWNER CITY/STATE/ZIP: Middlebury, IN 46540
LOCATION FID#: 19871
WORK ORDER NO: NE-0553

RUL SPILL BUCKET TEST START 11.5"

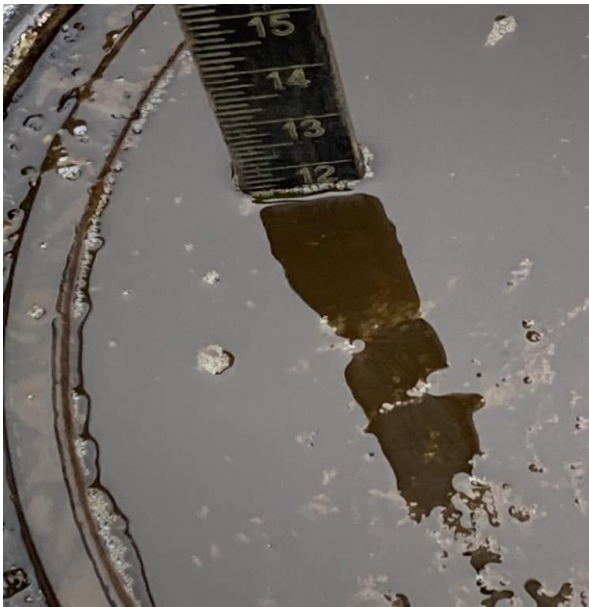

RUL SPILL BUCKET TEST END 11.5"



PUL SPILL BUCKET TEST START 14.5"



PUL SPILL BUCKET TEST START 14.5"



SITE PHOTOS


TEST DATE: 8/29/2023
LOCATION NAME: Snappy Food Mart
LOCATION ADDRESS: 53031 State Road 13
LOCATION CITY/STATE: Middlebury, IN 46540
LOCATION PHONE: 0
LOCATION CONTACT: Virender Kumar

OWNER NAME: Tanks Data
OWNER ADDRESS: 53031 State Road 13
OWNER CITY/STATE/ZIP: Middlebury, IN 46540
LOCATION FID#: 19871
WORK ORDER NO: NE-0553

DSL SPILL BUCKET TEST START 11"



DSL SPILL BUCKET TEST END 11"

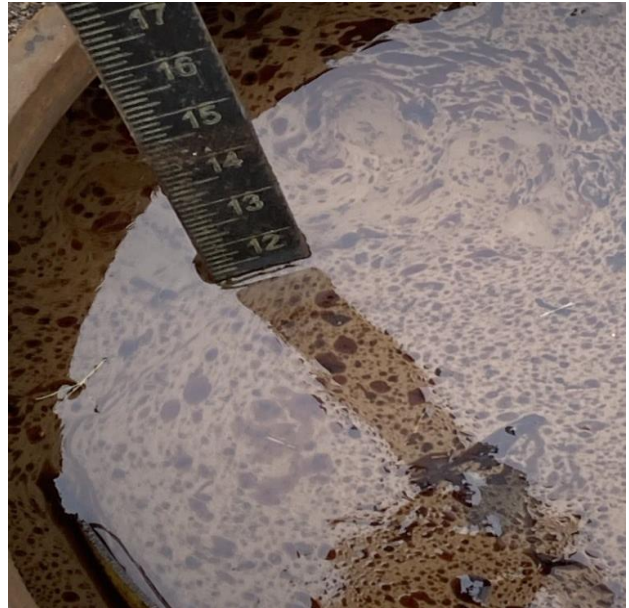

KER SPILL BUCKET TEST START 11.75"



KER SPILL BUCKET TEST END 9"





CERTIFICATION AFFIDAVIT

August 29, 2023

Tanks Data
53031 State Road 13
Middlebury, IN 46540

Testing Date: 8/29/2023
Snappy Food Mart
Location of Test: 53031 State Road 13
Middlebury, IN 46540
Site FID#: 19871
Service Technician: 0
Certified Technician: CHRIS HOWARD

Midwest ECS has completed the following tests/inspections at the above noted location:

ATG Functionality	
Leak Detector	
Elec Line Leak Detector	
Product Line Testing	
Liquid Sensor Functionality	
Spill Bucket	X
Containment Hydrostatic Sump	
Overfill Equipment Inspection	X
Overfill Alarm	
Vent Valve	
Interstitial	
Non-Volumetric Tank Tightness	
Shear Valve Inspection	

I, Chris Howard, the certified technician, was present throughout the duration of the testing and/or inspection performed by Midwest ECS at the above address on the above date. I affirm that the testing was done in accordance with Rule 329 IAC 9 and 40CFR Part 80, is accurate based upon the results received and that these forms accurately reflects the results of the testing and/or inspection.

Technician Signature: _____

Chris Howard

Technician Printed Name: _____ CHRIS HOWARD

Date & Time: _____ 8/30/2023 7:30



INDIANA HOMELAND SECURITY

Underground Storage Tank

CHRISTOPHER HOWARD
8923 LIMBERLOST COURT
CAMBY, INDIANA

STATE/PERMIT # UC111000
ISSUE 08/18/2022 EFFECTIVE 08/18/2022 EXPIRATION 08/18/2024

DISCIPLINES

☐ Installation or Retrofitting ☐ Decommissioning Closure
☐ Cathodic Protection ☐ Decommissioning Removal
☒ Testing



INDIANA HOMELAND SECURITY

Underground Storage Tank

CHRISTOPHER HOWARD
8923 LIMBERLOST COURT
CAMBY, INDIANA

STATE/PERMIT # UC111468
ISSUE 10/06/2022 EFFECTIVE 10/07/2022 EXPIRATION 10/06/2024

DISCIPLINES

☒ Installation or Retrofitting ☐ Decommissioning Closure
☐ Cathodic Protection ☐ Decommissioning Removal
☐ Testing



I attest with my signature below, that this technician was present during the testing as described above.