

APPENDIX C-4

CONTAINMENT SUMP INTEGRITY TESTING

HYDROSTATIC TESTING METHOD

TEST DATE: 10/10/2023
 LOCATION NAME: Midwest Petro
 LOCATION ADDRESS: 29026 State Road 20
 LOCATION CITY/STATE: Elkhart, IN 46517
 LOCATION PHONE: 317-645-0215
 LOCATION CONTACT: Tanks Data / Virendar Kumar

OWNER NAME: New Punjab LLC
 OWNER ADDRESS: 29026 State Road 20
 OWNER CITY/STATE/ZIP: Elkhart, IN 46517
 LOCATION FID#: 25595
 WORK ORDER NO: NE-0761

This procedure is to test the leak integrity of containment sumps. See PEI/RP1200 Section 6.5 for the test method.

Containment Sump ID	RUL STP	PUL STP	DSL STP	KER STP	DISP 1/2	DISP 3/4
Containment Sump Material	POLY	POLY	POLY	POLY	POLY	POLY
Containment Sump Depth	36"	36"	36"	36"	32"	32"
Height From Bottom to Top of Highest Penetration	8"	8"	8"	8"	8"	8"
Starting Water Level	15"	16"	17.75"	20"	16"	13"
Test Start Time	8:30	8:30	8:30	8:30	8:30	8:30
Ending Water Level	15"	14"	17.75"	20"	16"	13"
Test End Time	9:30	9:30	9:30	9:30	9:30	9:30
Test Period (Minimum test time: 1 hour)	1HR	1HR	1HR	1HR	1HR	1HR
Water Level Change	0"	2"	0"	0"	0"	0"
2. Ball float cage free of debris?	N/A	N/A	N/A	N/A	N/A	N/A
3. Ball free of holes an cracks and moves freely in cage?	N/A	N/A	N/A	N/A	N/A	N/A
4. Vent hole in pipe open and near top of tank?	N/A	N/A	N/A	N/A	N/A	N/A
HYDROSTATIC TEST RESULTS	PASS	FAIL	PASS	PASS	PASS	PASS
VISUAL INSPECTION RESULTS	PASS	PASS	PASS	PASS	PASS	PASS
Liquid and debris removed from sump?*	NO	YES	NO	YES	YES	YES

Visual Inspection Criteria: No cracks, loose parts or separation of the containment sump

Recommended Practices Pass/Fail criteria: Must pass visual inspection. Water level drop of less than 1/8 inch.

COMMENTS:

RUL & DSL STP SUMPS HAD WATER WHEN ARRIVED ON SITE. DID NOT HAVE ROOM ON VAC-TRAILER TO REMOVE AND TAKE.

* All liquids must be disposed of properly.


0

SERVICE TECHNICIAN NAME (printed)

ADAM WILDER

CERTIFIED TECHNICIAN NAME (printed)

SERVICE TECHNICIAN SIGNATURE

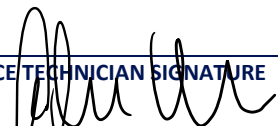

CERTIFIED TECHNICIAN SIGNATURE

CERT NO: UC112310

EXPIRATION DATE: 01/23/2025

APPENDIX C-4

CONTAINMENT SUMP INTEGRITY TESTING

HYDROSTATIC TESTING METHOD

TEST DATE: 10/10/2023
 LOCATION NAME: Midwest Petro
 LOCATION ADDRESS: 29026 State Road 20
 LOCATION CITY/STATE: Elkhart, IN 46517
 LOCATION PHONE: 317-645-0215
 LOCATION CONTACT: Tanks Data / Virendar Kumar

OWNER NAME: New Punjab LLC
 OWNER ADDRESS: 29026 State Road 20
 OWNER CITY/STATE/ZIP: Elkhart, IN 46517
 LOCATION FID#: 25595
 WORK ORDER NO: NE-0761

This procedure is to test the leak integrity of containment sumps. See PEI/RP1200 Section 6.5 for the test method.

Containment Sump ID	DISP 5/6	DISP 7/8	KER DISP			
Containment Sump Material	POLY	POLY	POLY			
Containment Sump Depth	32"	32"	32"			
Height From Bottom to Top of Highest Penetration	8"	8"	8"			
Starting Water Level	13.75"	17.5"	13.5"			
Test Start Time	8:35	8:35	8:35			
Ending Water Level	13.75"	17.5"	13.5"			
Test End Time	9:35	9:35	9:35			
Test Period (Minimum test time: 1 hour)	1HR	1HR	1HR			
Water Level Change	0"	0"	0"			
2. Ball float cage free of debris?	N/A	N/A	N/A			
3. Ball free of holes an cracks and moves freely in cage?	N/A	N/A	N/A			
4. Vent hole in pipe open and near top of tank?	N/A	N/A	N/A			
HYDROSTATIC TEST RESULTS	PASS	PASS	PASS	-	-	-
VISUAL INSPECTION RESULTS	PASS	PASS	PASS	-	-	-
Liquid and debris removed from sump?*	YES	YES	YES	-	-	-

Visual Inspection Criteria: No cracks, loose parts or separation of the containment sump

Recommended Practices Pass/Fail criteria: Must pass visual inspection. Water level drop of less than 1/8 inch.

COMMENTS:

* All liquids must be disposed of properly.


0

SERVICE TECHNICIAN NAME (printed)

ADAM WILDER

CERTIFIED TECHNICIAN NAME (printed)

SERVICE TECHNICIAN SIGNATURE



CERTIFIED TECHNICIAN SIGNATURE

CERT NO: UC112310

EXPIRATION DATE: 01/23/2025